ωιςιογουις Product description The mic+ sensor with two switching outputs measures the distance to



Operating Manual

mic+ Ultrasonic Sensors with two switching outputs

mic+25/EE/TC mic+35/EE/TC mic+130/EE/TC mic+340/EE/TC mic+600/DD/TC mic+600/EE/TC

Diagram 1: Set sensor parameters numerically using LED display

- justed detect distance the switching output is set. All settings are done with two pushbuttons and a three-digit LED-display (TouchControl).
 - Three-colour LEDs indicate the switching status.

contactless. Depending on the ad-

- The output functions are changeable from NOC to NCC.
- The sensors are adjustable manually via TouchControl or via Teach-in procedure.
- Useful additional functions are set in the Add-on-menu.
- Using the LinkControl adapter (optional accessory) all TouchControl and additional sensor parameter

Start here

Readv

settings can be adjusted by a Windows® Software.

Safety Notes an object within the detection zone

- Read the operating instructions prior to start-up.
- Connection, installation and adjustment works may only be carried out by expert personnel.
- No safety component in accordance with the EU Machine Directive, use in the area of personal and machine protection not permitted

Proper Use

mic+ ultrasonic sensors are used for non-contact detection of objects.

The mic+ sensors have a blind zone in which distance measurement is not possible. The operating range indicates the distance of the sensor that

can be applied with normal reflectors with sufficient function reserve. When using good reflectors, such as a calm water surface, the sensor can also be used up to its maximum range. Objects that strongly absorb (e.g. plastic foam) or diffusely reflect sound (e.g. pebble stones) can also reduce the defined operating range.

Synchronisation

If the assembly distances shown in Fig. 1 for two or more sensors are exceeded the integrated synchronisation should be used. Connect Sync/Comchannels (pin 5 at the units receptable) of all sensors (10 maximum).

		D↔Q	
mic+25	≥0.35 m	≥2.50 m	
mic+35	≥0.40 m	≥2.50 m	
mic+130	≥1.10 m	≥8.00 m	
mic+340	≥2.00 m	≥18.00 m	
mic+600	≥4.00 m	≥30.00 m	
Fig. 1: Assembly distances, indicating synchro- nisation/multiplex			

Multiplex mode

The Add-on-menu allows to assign an individual address »01« to »10« to each sensor connected via the Sync/ Com-channel (Pin5). The sensors perform the ultrasonic measurement sequentially from low to high address. Therefore any influence between the sensors is rejected.

The address »00« is reserved to svnchronisation mode and deactivates the multiplex mode. To use synchronised mode all sensors must be set to address »00«.

Installation


- → Assemble the sensor at the installation location.
- \rightarrow Plug in the connector cable to the M12 connector, see Fig. 2.

2 • • 1 3 • 5 • 4		colour
1	+U _B	brown
3	-U _B	blue
4	D2	black
2	D1	white
5	Sync/Com	grey

Fig. 2: Pin assignment with view onto sensor plug and colour coding of the microsonic connection cable

Start-up

 - \rightarrow Connect the power supply.
- → Set the parameters of the sensor manually via TouchControl (see Fig. 3 and Diagram 1)
- → or use the Teach-in procedure to adjust the detect points (see Diagram 2).



The sensor can be reset to its factory setting, see »Key lock and factory setting«, Diagram 3.

Show parameters

→ In normal operating mode shortly push T1. The LED display shows »PAr.«

Each time you tap push-button T1 the actual settings of the analogue output are shown.

Fig. 3: TouchControl/LED display Factory setting

mic+ sensors are delivered factory made with the following settings:

- Switching outputs on NOC
- Detecting distance at operating range and half operating range
- Measurement range set to maximum range

Maintenance


mic+ sensors work maintenance free. Small amounts of dirt on the surface do not influence function. Thick lavers of dirt and caked-on dirt affect sensor function and therefore must be removed.

Notes


- mic+ sensors have internal temperature compensation. Because the sensors heat up on their own, the temperature compensation reaches its optimum working point after approx. 30 minutes of operation.
- During normal operating mode, a yellow LED signals that the switching output has connected.
- During normal operating mode, the measured distance value is displayed on the LED-indicator in mm (up to 999 mm) or cm (from 100 cm). Scale switches automatically and is indicated by a point on top of the digits.
- During Teach-in mode, the hysteresis loops are set back to factory settings.
- If no objects are placed within the detection zone the LED-indicator shows »---«.
- If no push-buttons are pressed for 20 seconds during parameter setting mode the made changes are stored and the sensor returns to normal operating mode.

T1 + T2 HELL Press T1 and T2 simultaneously for about 3 s until welcome message has passed Set switching output D1 Set switching output D2 -T2 --T2 -T1 + T2Set detect distance in mm or cm T1 + T2 aentin ĭ For single switching For window mode operation set far point press T2 T2 until »– – –« is switching point in displayed. mm or cm T1 + T2 Choose » [~ « for NCC or « for NOC T1 + T2 T1 + T2

mic+25/DD/TC mic+35/DD/TC mic+130/DD/TC mic+340/DD/TC

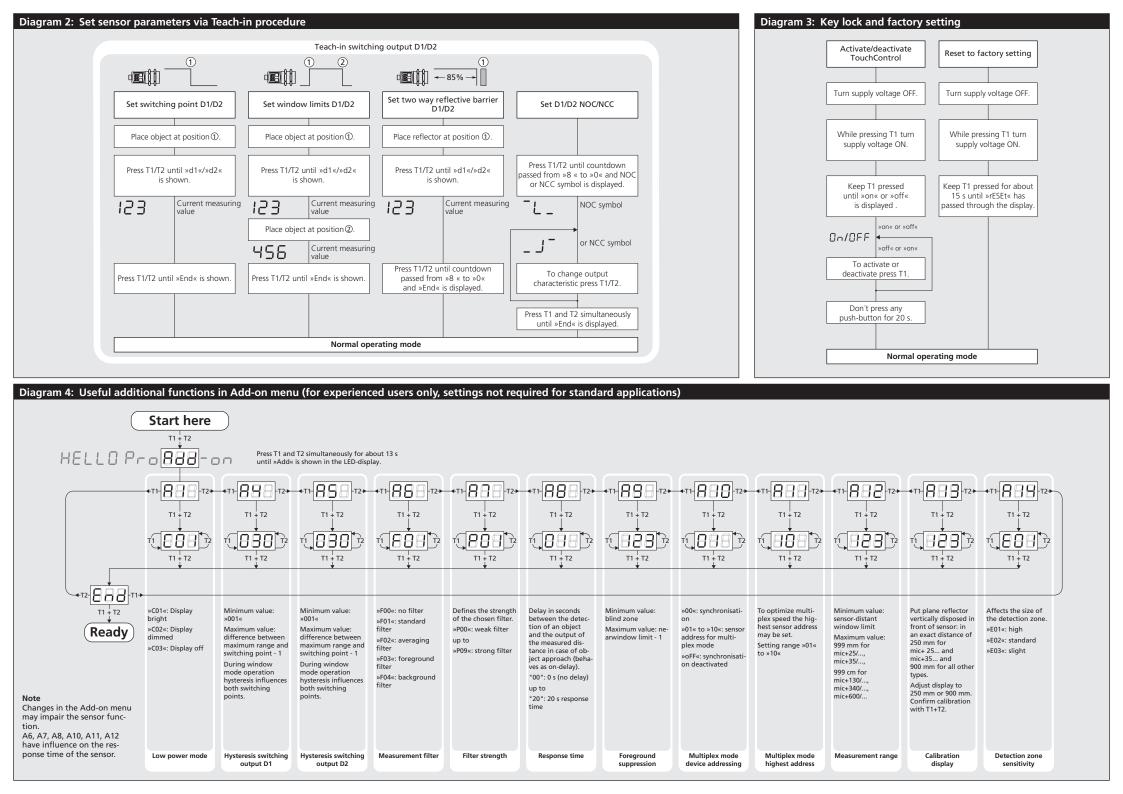



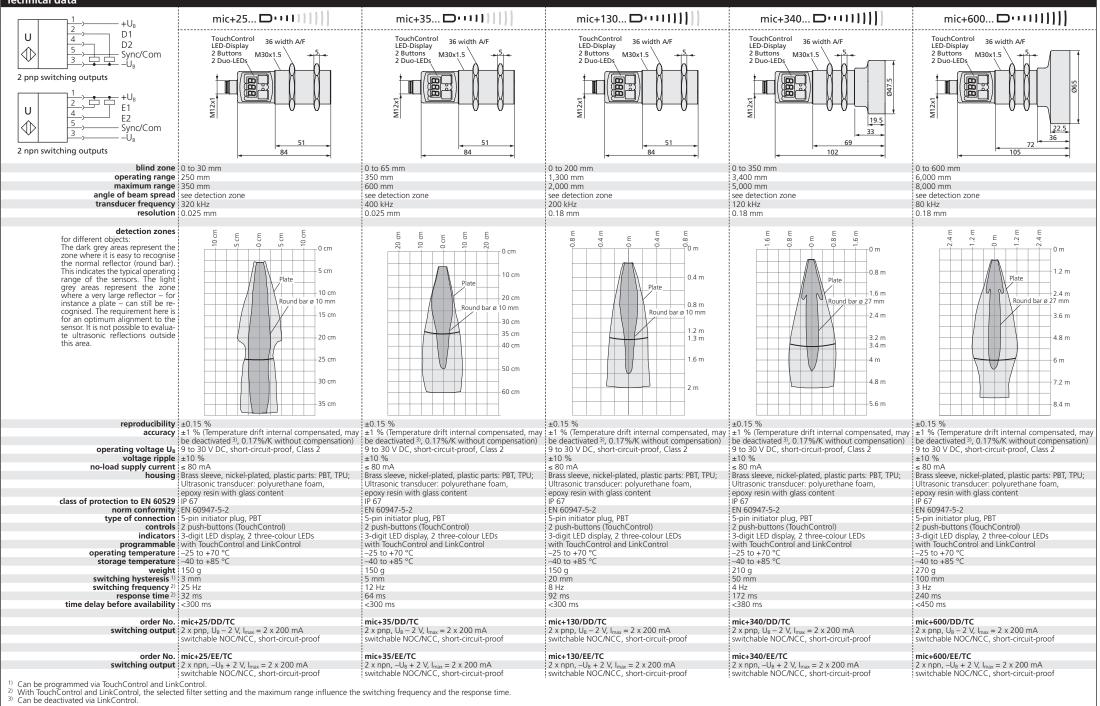

c (UL) us

LISTED

Enclosure Type 1 The proximity switches shall be used with a For use only in industrial Listed (CYJV/7) cable/connector assembly ra machinery NFPA 79 applications. ted minimum 32 Vdc, minimum 290 mÅ, the final installation



